


WARMAN METALS TUFF RIB



SCREW APPLICATION

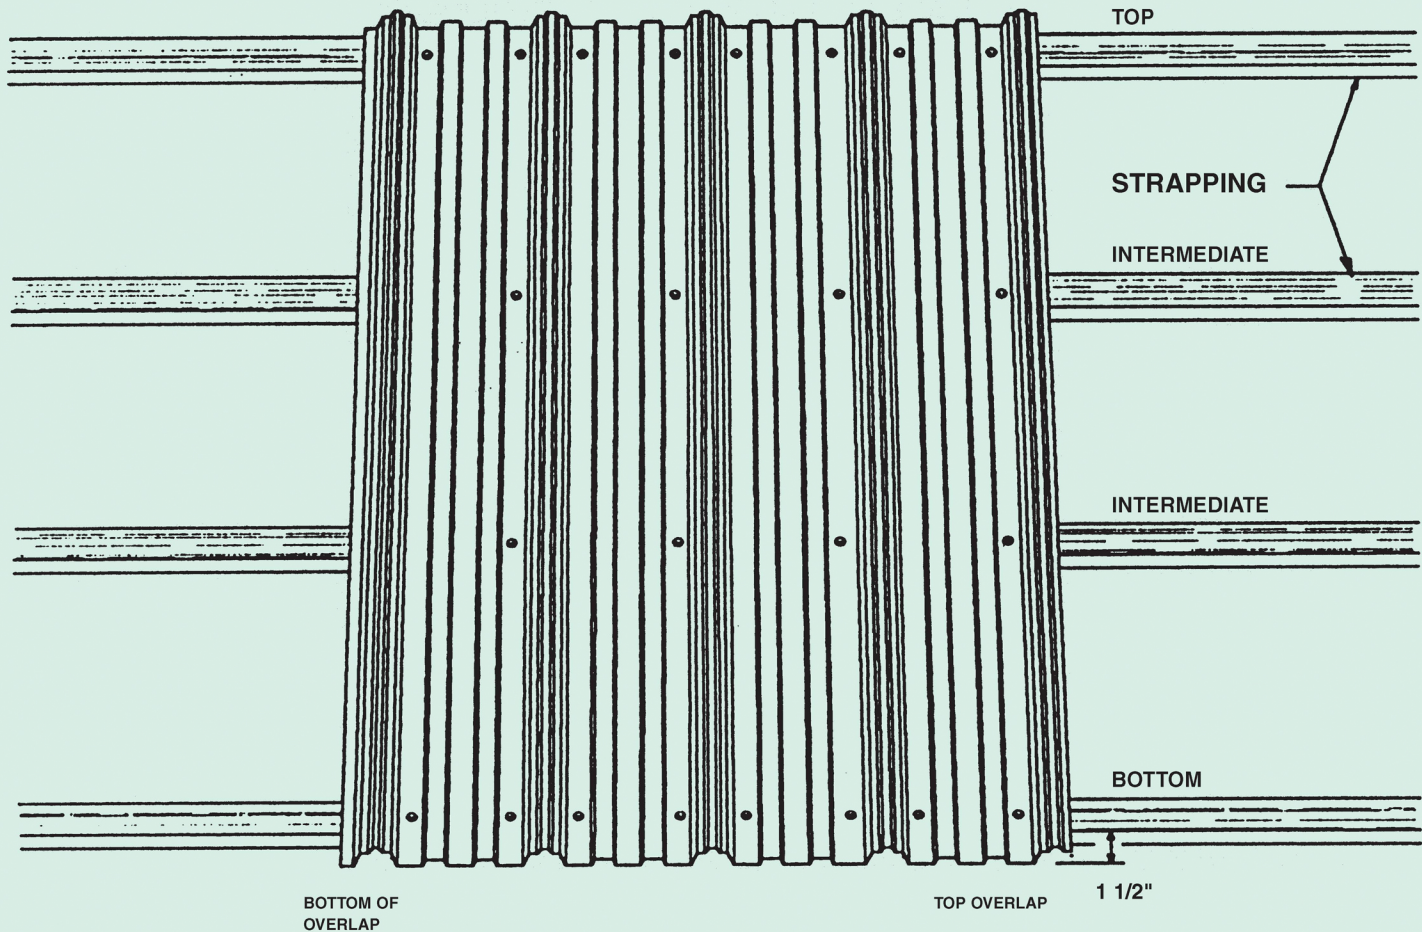

CORRECT

Sealing material slightly visible at edge of metal washer. Assembly is weather tight.




TOO LOOSE

Sealing material not visible. Not enough compression to seal properly.



TOO TIGHT

Metal washer deformed. Sealing material extruded beyond edge of washer.

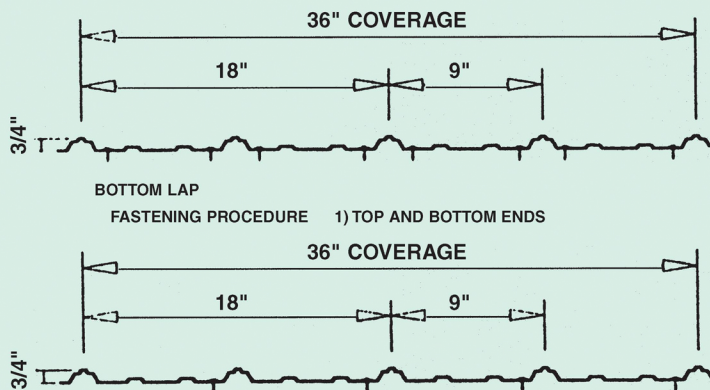

- 2) INTERMEDIATE - ONE FASTENER BESIDE RIB
- 3) MINIMUM FASTENER LENGTH 1"
- 4) WHEN ORDERING USE 100 SCREWS PER 100 SQUARE FEET

STRAPPING DISTANCE LOAD TABLES

ALLOWABLE LOADS (PSF)					
GAUGE		2'-0"	2'-6"	3'-0"	3'-6"
30 Gauge	S	123	79	55	40
	D	67	34	20	13

ALLOWABLE LOADS (PSF)					
GAUGE		2'-0"	2'-6"	3'-0"	3'-6"
29 Gauge	S	143	92	64	47
	D	79	40	23	15